

Integrated wrist temperature measurement system configuration guide V1.0




Catalog

1.Appearance	3
2.Introduction	4
3.Product result show	4
4.Temperature configuration	5
5.Advertisement configuration	8
5.1 Image/Video limits	9
5.2 Image/Video import configuration	9
6.Temperature search	10



1.Appearance

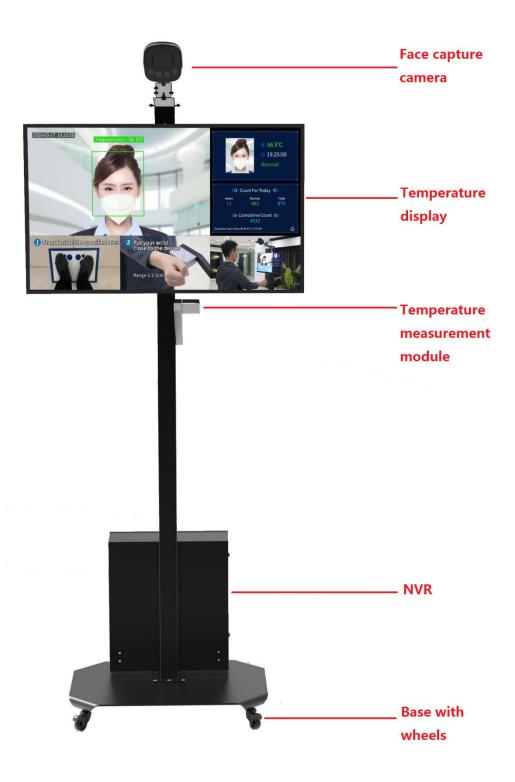



2.Introduction

Model: CW180

The product has several functions such as temperature measurement, advertisement, and video recording.

Function introduction:

- 1. Auto temperature measurement, image or video advertisement;
- 2.±0.5°C temperature measurement accuracy;
- 3. Voice broadcasting;
- 4. Face snapshot and real-time temperature display, face and temperature data search;
- 5.Real-time statistics of normal and abnormal body temperature;
- 6.Bracket can be lifted, suitable for children, adults and other groups;
- 7.Body temperature alarm pushes to EZview

3. Product result show



1.Stand inside the specified area



- 2.Put your wrist close to the device, range 1-2.5cm best
- 3.Look at the camera , when shows " normal" , please pass, when shows "abnormal" , please check further.


4. Temperature configuration

Plug the IPC into the first PoE port, When the IPC is online, the body temperature will auto start to detect. If some parameters need to adjust, please right click mouse and choose "Temperature Detection"




1.Body temperature detection is default enable



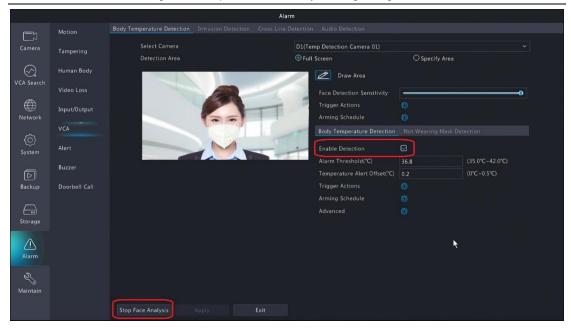


2.Set alarm threshold (exceed the temperature will alarm), default is 36.8°C

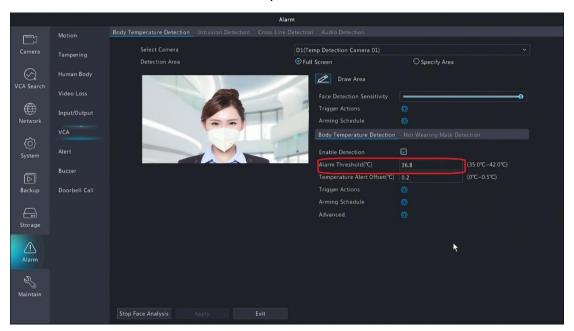

3.Set temperature alert offset, default is 0.2°C



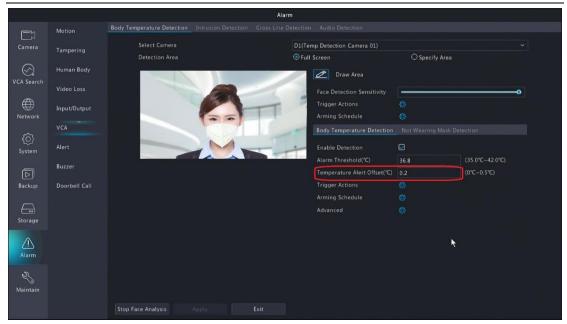

Q: How to understand the temperature alert offset?

A: Introduce a concept "warning temperature" (warning temperature=abnormal temperature-alert offset), when the actual temperature≥warning temperature, but <abnormal temperature, a warning alarm will generate to remind users the body temperature of the person is close to abnormal temperature

Example: Abnormal is 37°C, temperature alert offset is 0.2°C, and then the warning temperature is 37-0.2=36.8°C. When the measured actual temperature reaches 36.8°C, but not 37°C, a warning alarm will be generated. Please note that the temperature of this person is close to the abnormal temperature.

4. Voice broadcasting



Scene	Voice prompt
Face is too small	"Please get closer"
The target is normal, but the wrist is not detected	"Please expose your wrist"
Measurement result: normal temperature	"Normal Temperature"
Measurement result: body temperature exceeds the set	"Abnormal Temperature"
threshold	
Measurement results: body temperature close to the set	"Please take a temperature
threshold (warning)	manually"
Measurement result: if the body temperature is normal	
but the mask is not worn (i.e. the priority of abnormal	"Please wear a mask"
body temperature is higher than that without mask)	

5. Advertisement configuration

The advertisement area can be customized to import image and video





5.1 Image/Video limits

	Resolution	Recommend	Width/Height	Туре	Size
Image	Less than 500W (2592*1944)	1280*360	32:9	JPEG	Less than
Video	Less than 500W (2592*1944)	1920*1080	16:9	MP4	Less than 200MB

5.2 Image/Video import configuration

Need to copy images and video into U disk, and plug the U disk into NVR.

Then enter into "Import Custom Image" or "Import Custom Video" to choose image and video to import.



Note :1)Image/video will be auto saved to hdd when import from U disk. If no hdd, "Install hard disk first" will be prompted. U disk can not be removed until image/video has been imported successfully. (Users are not allow to remove U disk removed even if the image/video is imported success when NVR is not upgraded to NVR-B3801.18.31.C21102)

2) Repeat if someone wants to replace the image/video again .




6.Temperature search

1.Right click mouse, and choose "Temperature Search"





2. Search by body temperature range and time

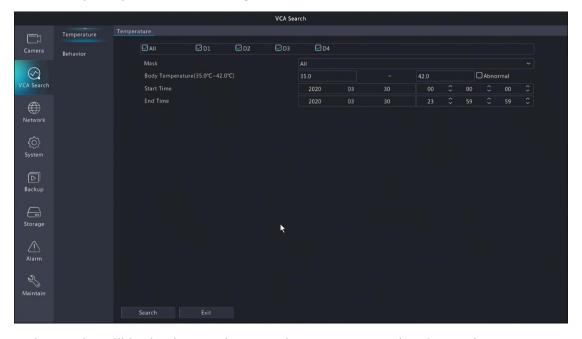

3. The results will be backup and export the temperature data in Excel .



